

Airworthiness Directive

▶ Federal Register Information

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

Amendment 39-1367; AD 72-01-01

Airworthiness Directives; Bellanca Model 14-19-2, 14-19-3, 14-19-3A and 17-30 Airplanes
PDF Copy (If Available):

▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

DATES: Effective December 31, 1971.

▼ Regulatory Information

72-01-01 BELLANCA: Amendment 39-1367. Applies to following airplanes:

Models	Serial Numbers Affected
14-19-2	4001 thru 4105
14-19-3	4106 thru 4228
14-19-3A	4229 thru 4342
17-30	30001 thru 30262

Compliance: Required as indicated unless already accomplished.

To detect leakage of flammable fluids from flexible hose assemblies in the engine compartment within 50 hour's time in service after the effective date of this AD and thereafter at intervals not to exceed 100 hours' time in service, accomplish the following:

A) Visually, or by any other method approved by FAA, inspect fuel lines as follows:

1. Pressurize the fuel lines with boost pump operating in high position. When accomplishing this test, the mixture control must be in the idle cutoff position.
2. With fuel lines pressurized, examine all flexible hose exteriors in the engine compartment for evidence of fuel stains, wetness or leakage.
3. After pressure testing fuel hoses, allow sufficient time for excess fuel to drain overboard from the engine manifold before attempting an engine start.

B) Visually, or by any other method approved by the FAA, inspect oil lines for evidence of wetness or leakage.

C) If, as a result of the inspections required by Paragraphs A or B, fuel or oil stains, wetness or leaking is found, replace with a serviceable hose assembly.

D) Inspections required by Paragraphs A and B will no longer be required when hose assemblies are replaced with assemblies identified by either a Bellanca metal identification band or a TSO-C53a Type C identification band. (This does not preclude continued inspections of this area as required by FAR 91.)

NOTE: The airplane models listed above use either Aeroquip 601 series or Stratoflex 156 series flexible fluid hoses in their engine compartments. These hose assemblies are available under Bellanca 198003-x series part numbers.

This amendment becomes effective December 31, 1971.

▼ Footer Information

▼ Comments

[FAA.gov Home](#) | [Privacy Policy](#) | [Web Policies & Notices](#) | [Contact Us](#) | [Help](#)

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)